



There is a range check error in UAPI version 6 when used for transcritical CO2 on chilled cabinets. This was corrected in version 7 (released 16/7/13).

There is a work around which allows version 6 to be used for CO2 chiller cabinets.

After doing the item 9 default setup with the bitswitch (item 960) set at 5 change the bitswitch setting to 6 to allow the correct range to be used for any subsequent adjustments.

TECHNICAL BULLETINS

Doc No 04210 Issue 0 Sept 2013